



2020





Adult Occupant



92%



Child Occupant

88%

Vulnerable Road Users



71%



Safety Assist

80%

SPECIFICATION

Tested Model	SEAT Leon 1.5 petrol 'XCELLENCE', LHD
Body Type	- 5 door hatchback
Year Of Publication	2020
Kerb Weight	1294kg
VIN From Which Rating Applies	- VSSZZZKLZMR005539 including PHEV
Class	Small Family Car

SAFETY EQUIPMENT

	Driver	Passenger	Rear
FRONTAL CRASH PROTECTION			
Frontal airbag	•		_
Belt pretensioner	•	•	•
Belt loadlimiter	•	•	•
Knee airbag	0	×	_
LATERAL CRASH PROTECTION			
Side head airbag	•		•
Side chest airbag	•	•	0
Side pelvis airbag	•	•	0
Centre Airbag	•	•	×



SAFETY EQUIPMENT (NEXT)

	Driver	Passenger	Rear
CHILD PROTECTION			
Isofix		•	•
Integrated CRS	<u> </u>	×	×
Airbag cut-off switch	_	•	_
SAFETY ASSIST			
Seat Belt Reminder	•	•	•

OTHER SYSTEMS	
Active Bonnet	×
AEB Vulnerable Road Users	
AEB Car-to-Car incl. Turn Across Path	
AEB Reverse	×
Speed Assistance	
Lane Assist System	•

Note: Other equipment m	nay be available on the	e vehicle but was not	considered in the test year.

Fitted to the vehicle as standard	Fitted to the vehicle as part of the safety pack
-----------------------------------	--

O Not fitted to the test vehicle but available as option or as part of the safety pack X Not available — Not applicable






Total 35.0 Pts / 92%





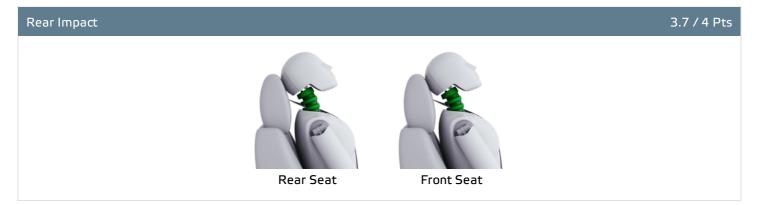





Total 35.0 Pts / 92%

GOOD	ADEQUATE	MARGINAL	WEAK	POOR	
Rescue and Extrication					2.0 / 2 Pts
	Rescue Sheet	Available, ISO compliant			PDF
	Advanced eCall	Available			
	Multi Collision Brake	Available			

Comments

The passenger compartment remained stable in the offset frontal test. Protection of the driver's chest was rated as marginal, based on dummy measurements of compression. Dummy measurements indicated good protection of the knees and femurs of both the driver and passenger. SEAT showed that a similar level of protection would be provided to occupants of different sizes and to those sitting in different positions. Analysis of the barrier into which the Leon crashed showed some localised areas of high deformation and a modest penalty was applied to the score for the risk this represented to the opposing vehicle. In the full-width, rigid wall test, protection was good or adequate for all critical body regions for both the driver and the rear seat passenger. In the side barrier test, representing a collision by another vehicle, protection of all critical body areas was good or adequate for all critical body areas. Similarly, in the more severe side pole impact, protection was at least adequate. In an assessment of protection in far-side impact, dummy excursion (its movement towards the other side of the vehicle) was rated as adequate. The Leon is equipped with a centre airbag to protect against occupant-to-occupant interaction in side impacts. This system worked well in Euro NCAP's test, with good protection of the head for both front seat occupants. Tests on the front seats and head restraints demonstrated good protection against whiplash injury in the event of a rear-end collision. A geometric assessment of the rear seats also indicated good whiplash protection. The Leon is equipped as standard with a multi-collision braking system, which applies the brakes immediately after an impact to prevent the vehicle from being involved in secondary impacts. The car also has an advanced e-Call system which, in the event of an accident, automatically sends a message to the emergency services, giving the car's location.



Total 43.4 Pts / 88%



Crash Test Performance based on 6 & 10 year old children

23.4 / 24 Pts





Restraint for 6 year old child: *Britax-Römer KidFix² S* Restraint for 10 year old child: *Booster cushion*

Safety Features 8.0 / 13 Pts

	Front Passenger	2nd row outboard	2nd row center
Isofix	•	•	×
i-Size	•	•	×
Integrated CRS	×	×	×

Fitted to test car as standard

O Not on test car but available as option

🗶 Not available



CRS Installation Check 12.0 / 12 Pts



i-Size CRS












ISOFIX CRS









Total 43.4 Pts / 88%

Universal Belted CRS











Total 43.4 Pts / 88%

	Seat Position			
	Front		2nd row	
	PASSENGER	LEFT	CENTER	RIGHT
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	•	•	_	
Maxi Cosi 2way Pearl & 2wayFix (i-Size)	•	•	_	
BeSafe iZi Kid X2 i-Size (i-Size)	•	•	_	•
Britax Römer TriFix2 i-Size (i-Size)	•	•	_	•
BeSafe iZi Flex FIX i-Size (i-Size)	•	•	_	•
BeSafe iZi Combi X4 ISOfix (ISOFIX)	•	•	_	•
Britax Römer KidFix XP (ISOFIX)	•	•	_	•
Maxi Cosi Cabriofix (Belt)	•	•	•	•
Maxi Cosi Cabriofix & EasyBase2 (Belt)	•	•	×	•
Britax Römer King II LS (Belt)	•	•	•	•
Britax Römer KidFix XP (Belt)	•	•	•	•

Install without problem

Install with care

Safety critical problem

★ Installation not allowed

— Not available

Comments

In the frontal offset test, protection of both child dummies was good except for the neck of the 10 year dummy, protection of which was adequate. In the side barrier test, protection of all critical body regions was good and the Leon scored maximum points for this part of the assessment. The front passenger airbag can be disabled to allow a rearward-facing child restraint to be used in that seating position. Clear information is provided to the driver regarding the status of the airbag and the system was rewarded. All of the restraints for which the Leon is designed could be properly installed and accommodated.



★ VULNERABLE ROAD USERS

Total 38.5 Pts / 71%

GOOD	ADEQUATE	MARGINAL	WEAK	POOR	

Pedestrian 26.9 / 36 Pts



Head Impact	14.9 Pts
Pelvis Impact	6.0 Pts
Leg Impact	6.0 Pts


Vulnerable Road Users 11.6 / 18 Pts

System Name	Front Assist
Туре	Auto-Brake with Forward Collision Warning
Operational From	5 km/h



Total 38.5 Pts / 71%

AEB Pedestrian





Vehicle reversing into standing pedestrian



Pedestrian crossing a road into which a car is turning


Adult crossing the road



Child running from behind parked vehicles



Adult along the roadside

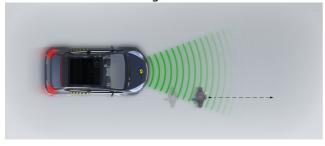


Night time

Adult crossing the road



Adult along the roadside

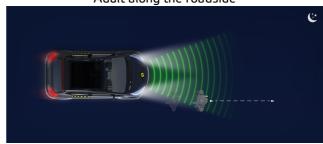






Total 38.5 Pts / 71%

AEB Cyclist







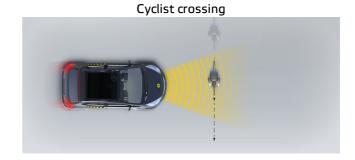


Cyclist along the roadside



Comments

The bonnet surface provided predominantly good or adequate protection to the head of a struck pedestrian, with weak and poor results recorded on the stiff windscreen pillars. The bumper provided good protection to pedestrians' legs and protection of the pelvis was also good at all test positions. The Leon's autonomous emergency braking (AEB) system can detect vulnerable road users like pedestrians and cyclists, as well as other vehicles. In tests, the system's response to such road users was adequate, with collisions avoided or mitigated in most cases. The system does not detect pedestrians to the rear of the car, and reversing tests were not performed.



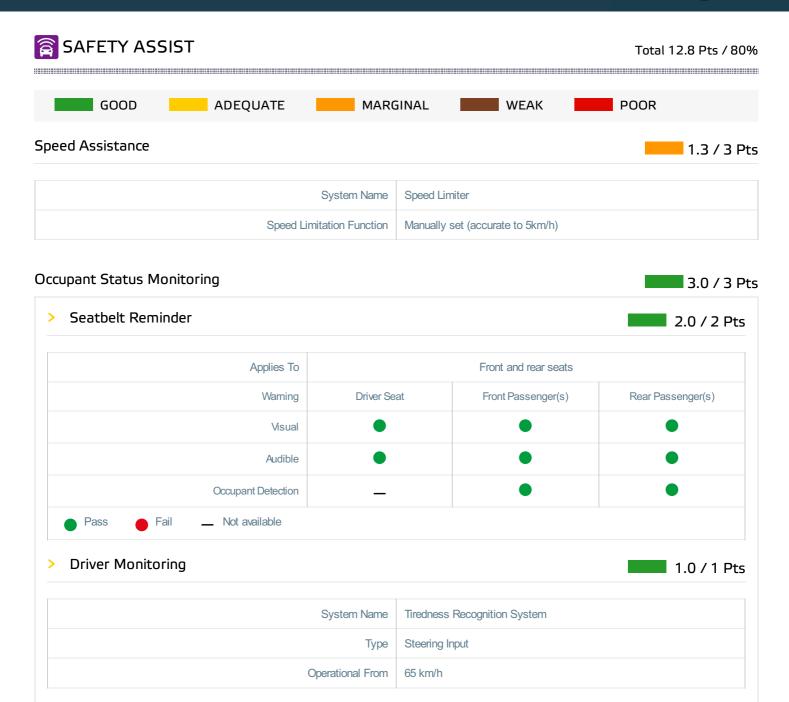





Lane Support 3.5 / 4 Pts

System Name	Lane Assist
Туре	LKA and ELK
Operational From	65 km/h
PERFORMANCE	
Emergency Lane Keeping	GOOD
Lane Keep Assist	GOOD
Human Machine Interface	GOOD

AEB Car-to-Car 5.1 / 6 Pts


System Name	Front Assist
Туре	Autonomous emergency braking
Operational From	5 km/h
Sensor Used	camera and radar







Autobrake function only

Test car turns across the path of an approaching car

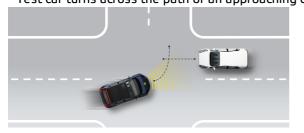

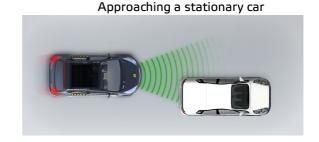


Approaching a stationary car

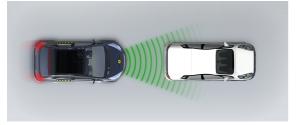


Approaching a stationary car



Approaching a slower moving car

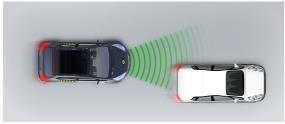

Approaching a slower moving car

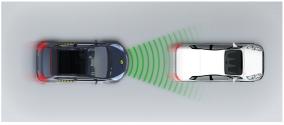

Approaching a slower moving car




Approaching a braking car






Driver reacts to warning


Approaching a stationary car

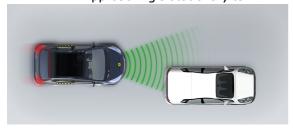


Approaching a stationary car

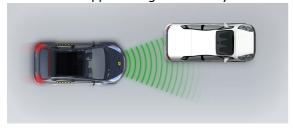


Approaching a slower moving car

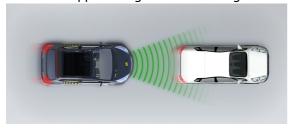


Approaching a braking car

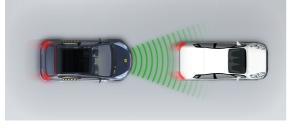

Approaching a stationary car

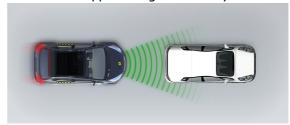

Approaching a slower moving car

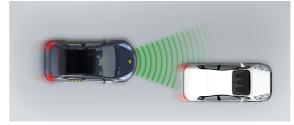

Approaching a slower moving car







Comments

Autonomous emergency braking (AEB) is fitted as standard. The system performed well in tests of its detection and reaction to other vehicles, with impacts being avoided or mitigated in most cases. As well as a seatbelt reminder for front and rear seats, the Leon has a driver monitoring system which uses steering inputs to identify whether the driver is alert and focussed on the driving task or is impaired through fatigue or other factors. The system warns the driver if impaired driving is detected. The lane support system gently corrects the steering of the car if it is drifting out of lane and also intervenes much more aggressively in some critical situations. A driver-set speed limiter is fitted as standard and is the speed assistance system rated here. A more advanced system is available as an option which identifies local speed limits.



RATING VALIDITY

Variants of Model Range

Body Type	Engine	Model Name/Code	Drivetrain	Rating Applies	
				LHD	RHD
5 door hatchback and 5 door estate	1.0 petrol	TSI	4 x 2	✓	✓
5 door hatchback and 5 door estate	1.0 petrol MHEV	eTSI	4 x 2	✓	✓
5 door hatchback and 5 door estate	1.5 petrol*	TSI	4 x 2	✓	✓
5 door hatchback and 5 door estate	1.5 petrol MHEV	eTSI	4 x 2	✓	✓
5 door hatchback and 5 door estate	2.0 diesel	TDI	4 x 2	✓	✓
5 door hatchback and 5 door estate	1.5 petrol CNG	TGI	4 x 2	✓	✓
5 door hatchback and 5 door estate	1.4 petrol PHEV	e-Hybrid	4 x 2	✓	✓

^{*} Tested variant

Annual Reviews and Facelifts

Date	Event	Outcome		
December 2020	Rating Published	2020 ★ 🖈 🖈 ★	✓	